


SPECIFICATIONS		NOTICE	
Current Output		1. CALIBRATION MATERIAL MODEL WKN-142T 2-wire Vibration Transmitters are calibrated with JIS SCM440 (AISI 4140 equivalent) flat surface (more than 15 mm dia.). It is not calibrated with any other target.	
4 to 20 mA OUTPUT RANGE	-0.6 to 0 to +0.6 mm or -0.635 to 0 to +0.635 mm (-25 to 0 to +25 mils)		
4 to 20 mA OUTPUT CONVERSION ACCURACY	±1.5 % of Full Scale Range (From test signal input pin to current output)		
MAX. LOAD RESISTANCE	43.5 × (Vps-12) Ω (Vps=Power supply voltage)		
NOT-OK FUNCTION	Current output : 3.6 mA or less. Not-OK condition : Open or short of sensor, Outside of linear range. Delay time to resume ; 2 to 3 seconds after Not-OK condition is removed.		
GAP Output			
CALIBRATION MATERIAL	JIS SCM440 FLAT (AISI 4140 equivalent)		
LINEAR RANGE*	1.4 mm (Gap : 0.3 to 1.7 mm)		
SCALE FACTOR*	7.87 mV/μm		
SCALE FACTOR ERROR*	7.87 mV/μm ±6.5 % typ. (including interchangeability errors) Step : 200 μm, Target : 30 mm dia.		
LINEARITY*	Within ±30 μm (typ.) of 7.87 mV/μm straight line (including interchangeability errors) Step : 200 μm, Target : 30 mm dia.		
OUTPUT IMPEDANCE*	10 kΩ (It is calibrated load impedance at 10 MΩ)		
System		2. CONNECTOR ISOLATION, etc. The connector connecting the sensor cable and the extension cable shall be insulated with the attached insulation sleeve (transparent shrink tube) or fluoro resin insulation tape. The vinyl-insulating tape shall not be used, which may cause the wiring trouble in the case of the temperature more than 80 °C. The connector shall not be located in the oil environment. The oil penetration to cable through the connector may cause the sensitivity change, due to the change of the cable capacitance.	
TEMPERATURE RANGE OF TRANSMITTER	Operating : 0 to 70 °C (32 to 158 °F) Storage : -34 to +100 °C (-29 to +212 °F)		
TEMPERATURE RANGE OF SENSOR AND EXTENSION CABLE	Operating : -34 to +177 °C (-29 to +350 °F) (Connector : Max. 125 °C (257 °F)) Storage : -34 to +177 °C (-29 to +350 °F) (Connector : Max. 125 °C (257 °F))		
RANGE OF TEMPERATURE AT EXPLOSION PROOF CONSTRUCTION	CSA,ATEX : 0 to +70°C (Sensor, Ext. Cable & Transmitter)		
RELATIVE HUMIDITY RANGE	30 to 95 %RH (non condensing)		
POWER SUPPLY VOLTAGE	12 to 35 VDC		
SENSOR TIP DIAMETER	Approx. 5.5 mm (0.217 inch) dia.		
CABLE DIAMETER	Approx. 2.7 mm (0.106 inch) dia.		
CONNECTOR DIAMETER	Approx. 7.1 mm (0.280 inch) dia.		
SYSTEM CABLE LENGTH	5 m or 7 m		
TRANSMITTER SIZE	WKN-142T□-□-1 (L) 90 mm × (W) 40 mm × (H) 46.2 mm (3.54 in) (1.57 in) (1.82 in) WKN-142T□-□-2 (L) 90 mm × (W) 74 mm × (H) 45.2 mm (3.54 in) (2.91 in) (1.78 in) Mass : Approx. 200 g (0.44 lb)		
APPLICABLE WIRE GAUGE	0.2 to 1.5 mm ² (1.0 mm ² recommended)		
*The above specifications apply at 25 °C with 24 VDC power supply and SCM440 (AISI 4140 equivalent) steel flat target.			
			3. MEGGER TEST OF SIGNAL CABLE If megger test is made on the signal cable (2-wire shielded cable), be sure to discharge the charged electric load before connecting the cable to transmitter. If this caution is not adhered the transmitter could be damaged.
			4. WIRING BETWEEN GAP OUT TERMINAL AND EQUIPMENT a). Non-grounding type equipment Connect directly with coaxial cable within 3 meters long. b). Grounding type equipment Use an isolator between the transmitter and the equipment. Use coaxial cable within 3 meters long between the transmitter and the isolator.
			5. INSTALLATION ENVIRONMENT Not available for rainwater at out door use and for occurring place of corrosive gasses. It may cause the sensitivity change and insulation down.
			6. The instructions manual contains important information such as conditions necessary for safe handling of the system. Such information and conditions are important and indispensable for ensuring safety. Therefore, be sure to read the instructions manual thoroughly before handling the system.
			Other
		<u>Geothermal specification (Additional Spec. Code: /GEO) is not applicable.</u>	

CONFIGURATION

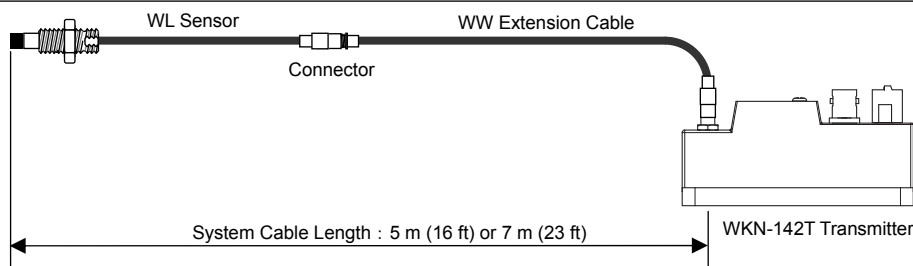

Model Code / Additional Spec. Code (No entry if additional spec. code is not specified.)

• Transmitter

WKN-142T * - * - * / NB1

System cable length		Output range		Mounting plate		Non-incendive	
1	5 m	1	-0.6 to 0 to +0.6 mm	1	35 mm DIN Rail mounting plate	1	CSA C/US: Class I, Division 2, Groups A,B,C and D ATEX:Ex nA II T4 Gc
2	7 m	2	-0.635 to 0 to +0.635 mm (-25 to 0 to +25 mils)	2	Screw mounting plate		

• Extension Cable

WW-142K * - * / NB1

Armor		Extension cable length		Non-incendive	
A	With (Without Fluoro resin coating)	1	4.0 m	1	CSA C/US: Class I, Division 2, Groups A,B,C and D ATEX:Ex nA II T4 Gc
T	With (With Fluoro resin coating)	2	4.5 m		
L	Without	3	6.0 m		
		4	6.5 m		

• Sensor

WL-142K05 * - * * * * * * / NB1

Armor		Thread size		Unthreaded length* (L1)		Case length* (L2)		Cable length (L3)		Non-incendive	
A	With (Without Fluoro resin coating)	M1	M8 X 1	10 mm step, 0 to 230 mm		10 mm step, 20 to 250 mm		1	0.5 m	1	CSA C/US: Class I, Division 2, Groups A,B,C and D ATEX:Ex nA II T4 Gc
		M2	M10 X 1	e.g.) 06=60 mm, L1≤L2-20 mm		e.g.) 25=250 mm		2	1.0 m		
		U1	1/4-28 UNF-2A	0.1 in step, 0 to 9.2 in		0.1 in step, 0.8 to 9.9 in		3	5.0 m		
		U2	3/8-24 UNF-2A	e.g.) 04=0.4 in, L1≤L2-0.7 in		e.g.) 35=3.5 in		4	7.0 m		
T	With (With Fluoro resin coating)	* inch for UNF-2A thread mm for M thread									
L	Without										

WL-142K05R - * * * * * / NB1

Thread size		Unthreaded length*		Case length*		Cable length (L3)		Non-incendive		
M2	M10 × 1	05=5mm		30=30mm		1	0.5 m	1	CSA C/US: Class I, Division 2, Groups A,B,C and D ATEX:Ex nA II T4 Gc	
U2	3/8-24 UNF-2A	02=0.2inch		12=1.2inch		2	1.0 m			
							3			5.0 m
							4			7.0 m

* inch for UNF-2A thread
mm for M thread